

Light Measurement Results

Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	1/20/2026

Measurement Conditions

Tested c-planes	24
Tested gamma angles	37 – 5.00°
Input Power	17.73 W


Tested Light Source

Luminaire	48V CLICK Track System LED Liner M Black 17W CCT
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	RIM-40009-273340

Main Light Measurement Results


Output – Total Lumen (Up% / Down%)	642.1 lm – 0.0019% / 100%
Efficiency	36.21 lm/W
Peak Intensity	221.4 cd
Correlated Color Temperature, CCT	2955 K
Color Rendering Index	CRI 92.9

Polar light distribution diagram

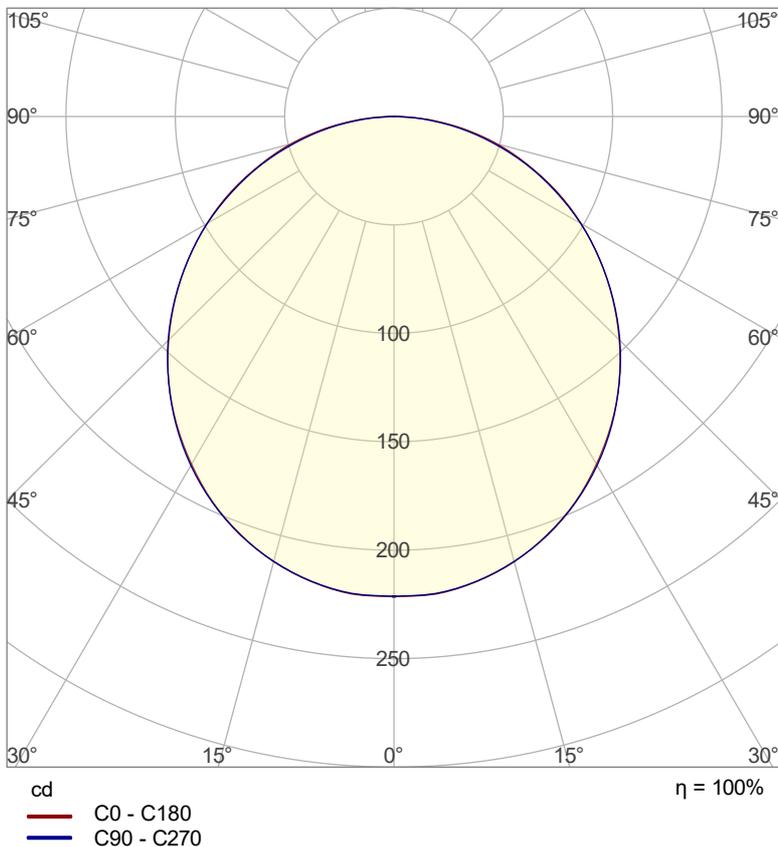


Light Measurement Results

Beam details

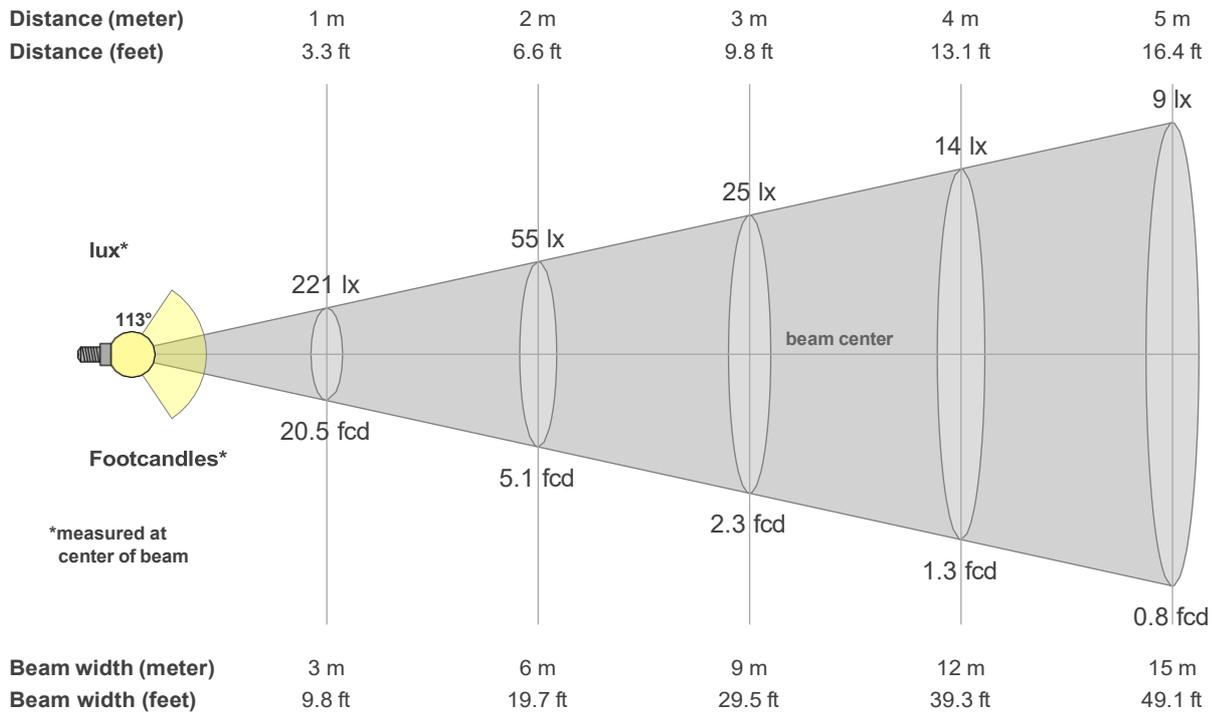


Luminaire budgetary diagram

LAMPS (number of lamps)

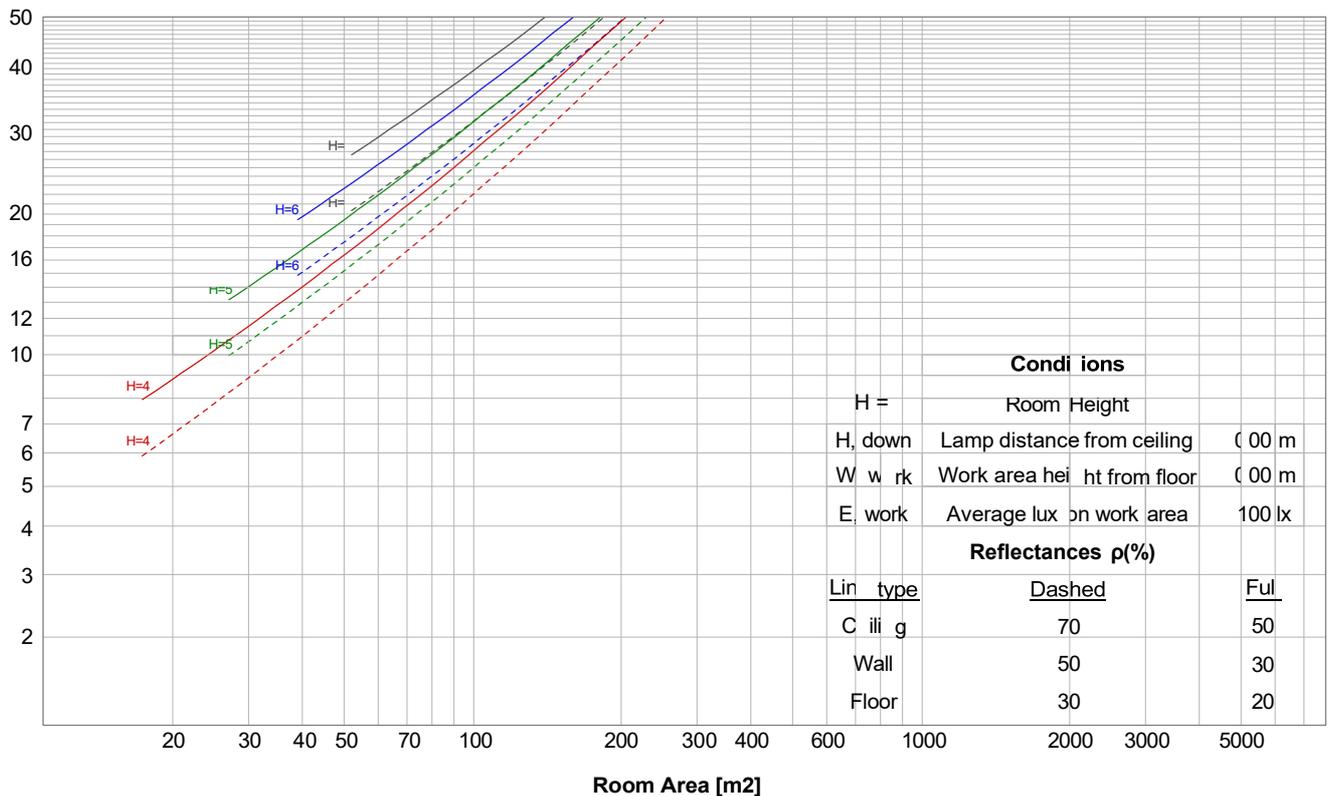


Light Measurement Results

Iso-intensity Diagram (Iso-candela)

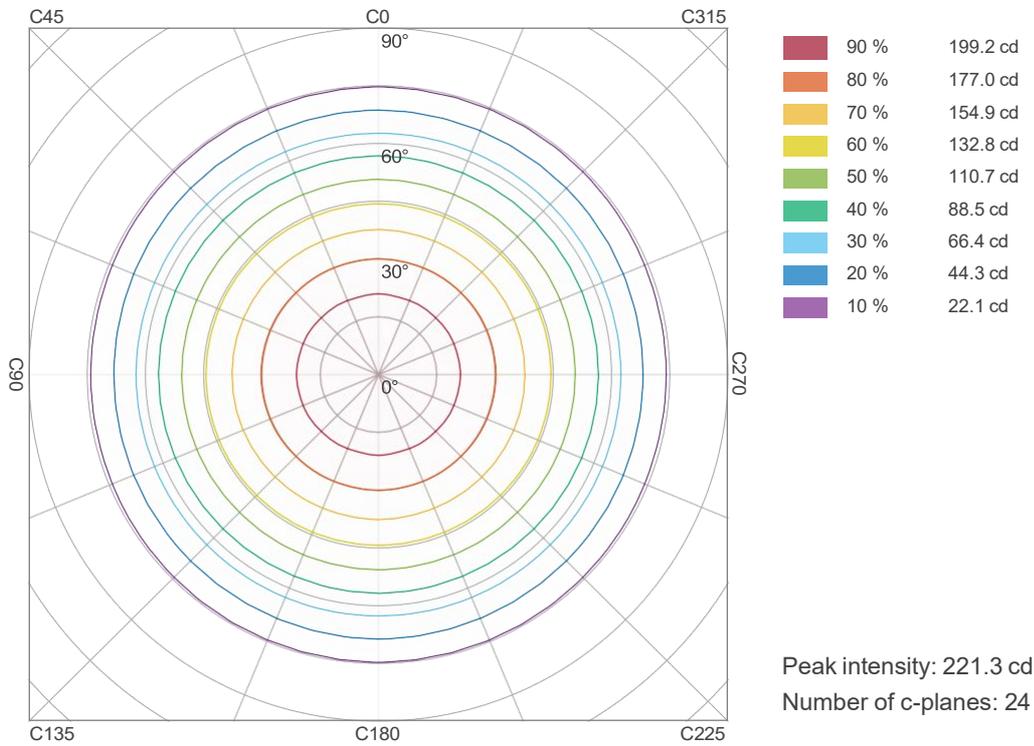


Iso-illuminance Diagram (Iso-lux)

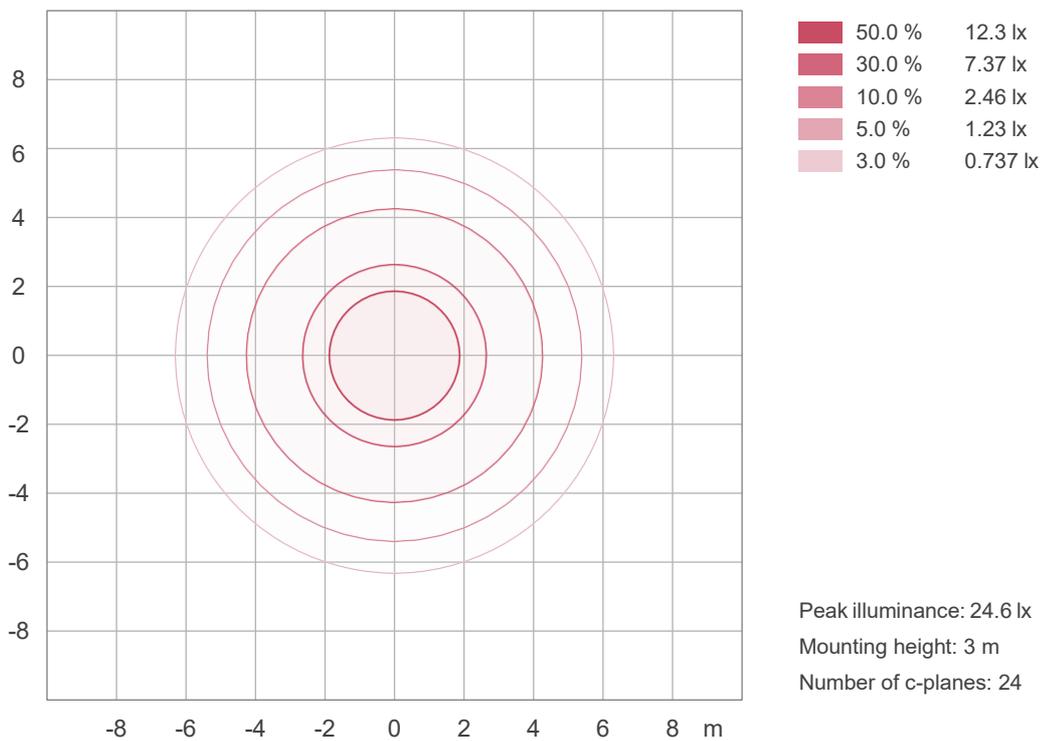


Light Measurement Results

Linear intensity distribution diagram

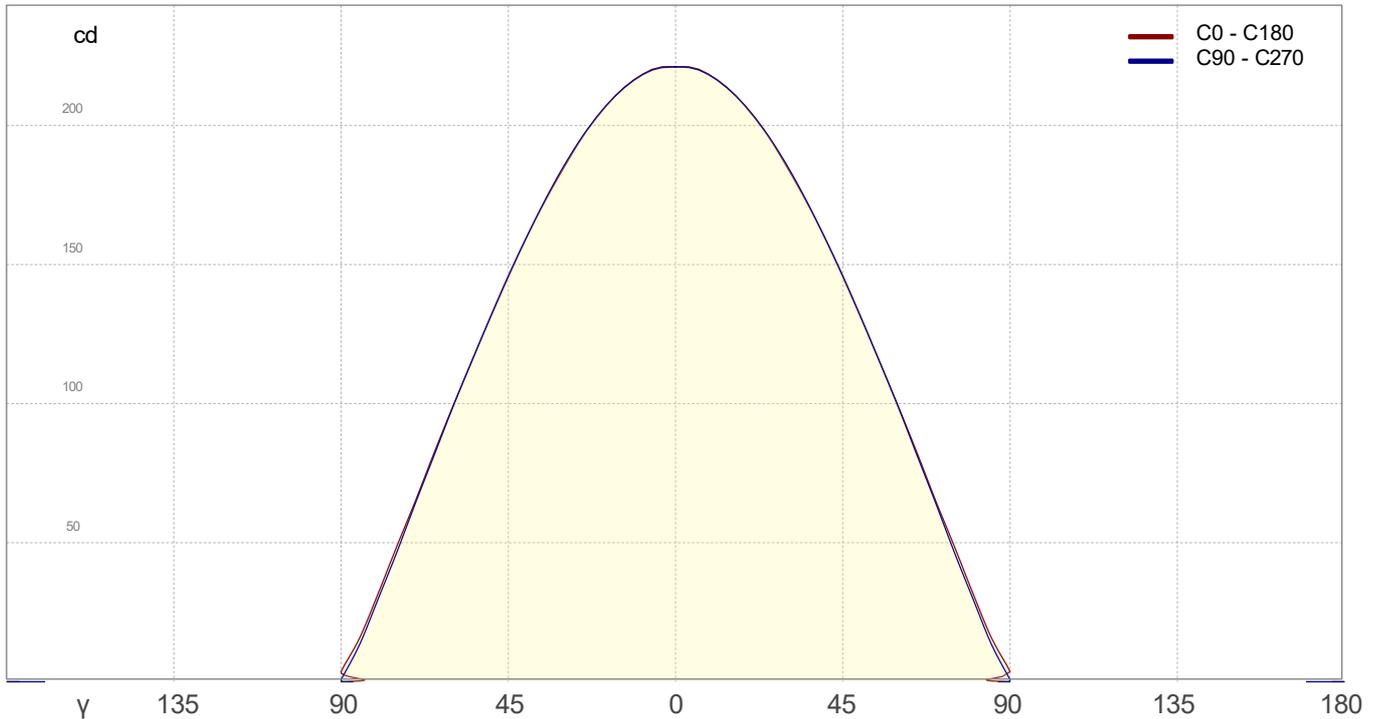

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B0 U0 G0

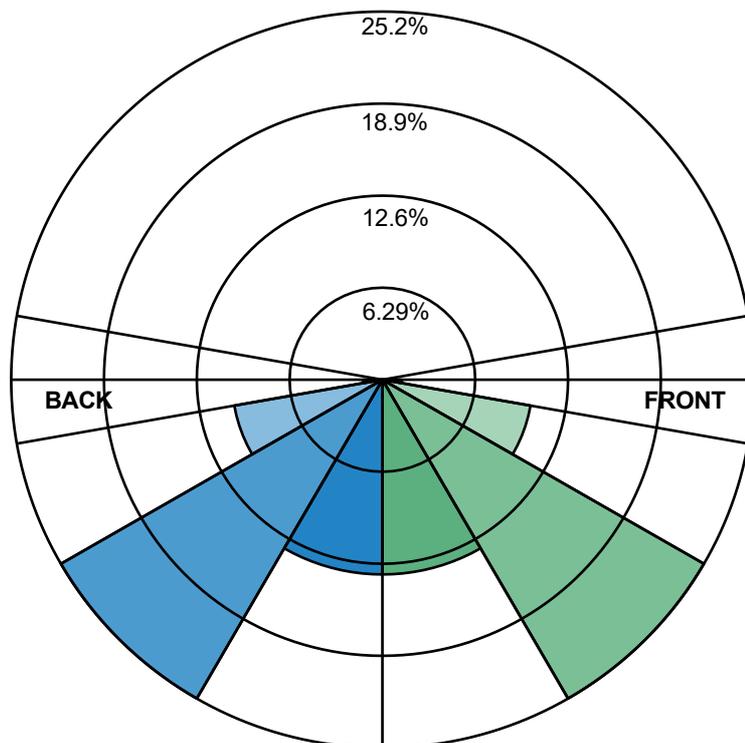

Forward Light

Low (0-30°)	85.5 lm	13.3%
Medium (30-60°)	161.6 lm	25.2%
High (60-80°)	65.5 lm	10.2%
Very High (80-90°)	8.5 lm	1.3%

Back Light

Low (0-30°)	85.5 lm	13.3%
Medium (30-60°)	161.6 lm	25.2%
High (60-80°)	65.5 lm	10.2%
Very High (80-90°)	8.5 lm	1.3%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	642.1 lm	100,0%
-----	----------	--------